

Advisory Number: SPA-24-03-01



Dealer Advisory

ROPS Installation

Advisory Type	Informational
Affected Units	Crated mowers that require ROPS.
Situation	Some ROPS have been installed incorrectly as dealers prepare crated mowers for sale.
Dealer Action	Review the lower installation picture to ensure ROPS are correctly installed.

Below are pictures of ROPS that are installed incorrectly. The upper ROPS mounting holes are positioned towards the front of the mower (incorrectly). When the ROPS are folded down, the pin holes will not line up. (Figure 3)

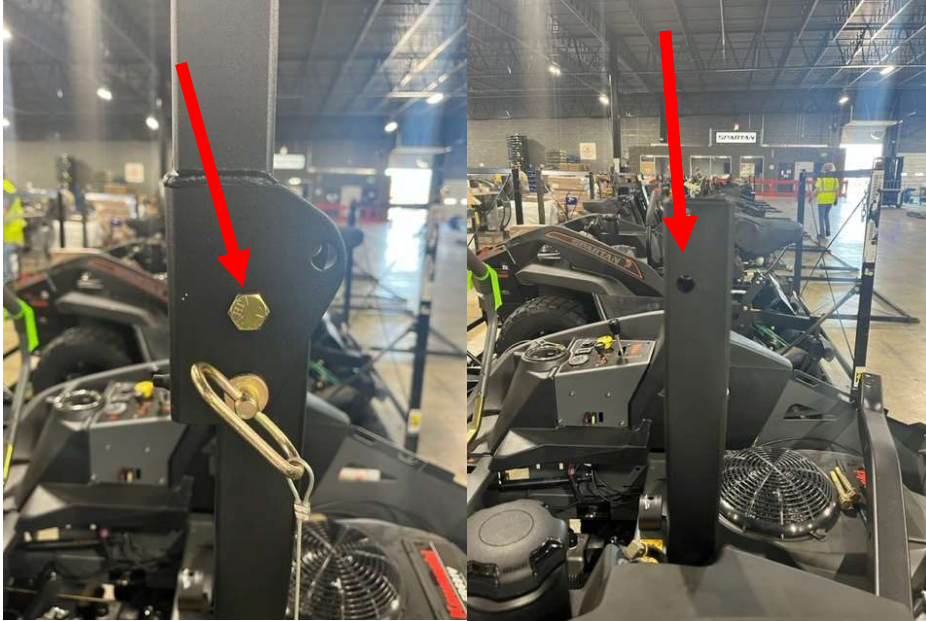


Figure 1

Figure 2



Figure 3

Install the lowers ROPS brackets with the upper ROPS mounting holes positioned towards the rear of the mower, so that the folded position has proper pin hole alignment.



Figure 4



Figure 5



Figure 6